

SOUND GENERATOR



K4401

Sound effects, tunes, sirens ... 10 of them at the touch of a button.



Features:

☑ 10 different Sounds : Sirens, Machine gun, Mortar, Car engine...

☑ Adjustable sound speed.

 $\ \ \square$ Push-button keyboard.

Specifications:

· Loudspeakers output: 8 ohm/1W

· Line output : 1VRms.

• Power supply: 8 - 10VDC (9v battery).

Max. current consumption: 100mA

• Secured against polarity reversal of the supply voltage.

Effects:

- Machine-gun (random number of shots with bullet impact).
- · European siren.
- Phasor gun (STAR-WARS-like machine-gun).
- Racing-car engine (increase/decrease the number of r.p.m.).
- · Car tire screech
- · Explosion.
- Mortar shot followed by an explosion.
- Tune: "Wild charge tune".
- · Tune: "Snake charmers tune".
- · U.S.A. siren.



1. Assembly (Skipping this can lead to troubles!)

Ok, so we have your attention. These hints will help you to make this project successful. Read them carefully.

1.1 Make sure you have the right tools:

- A good quality soldering iron (25-40W) with a small tip.
- Wipe it often on a wet sponge or cloth, to keep it clean; then apply solder to the tip, to give it a wet look. This is called 'thinning' and will
 protect the tip, and enables you to make good connections. When solder rolls off the tip, it needs cleaning.
- Thin raisin-core solder. Do not use any flux or grease.
- A diagonal cutter to trim excess wires. To avoid injury when cutting excess leads, hold the lead so they
 cannot fly towards the eyes.
- Needle nose pliers, for bending leads, or to hold components in place.
- Small blade and Phillips screwdrivers. A basic range is fine.

1.2 Assembly Hints :

⇒ Make sure the skill level matches your experience, to avoid disappointments.

For some projects, a basic multi-meter is required, or might be handy

- ⇒ Follow the instructions carefully. Read and understand the entire step before you perform each operation.
- ⇒ Perform the assembly in the correct order as stated in this manual
- \Rightarrow Position all parts on the PCB (Printed Circuit Board) as shown on the drawings.
- \Rightarrow Values on the circuit diagram are subject to changes.
- ⇒ Values in this assembly guide are correct*
- \Rightarrow Use the check-boxes to mark your progress.
- ⇒ Please read the included information on safety and customer service






^{*} Typographical inaccuracies excluded. Always look for possible last minute manual updates, indicated as 'NOTE' on a separate leaflet.



1.3 Soldering Hints:

1- Mount the component against the PCB surface and carefully solder the leads

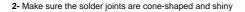



3- Trim excess leads as close as possible to the solder joint





REMOVE THEM FROM THE TAPE ONE AT A TIME!

AXIAL COMPONENTS ARE TAPED IN THE COR-RECT MOUNTING SEQUENCE!






D7

□ D9

1. Diodes. Watch the polarity!

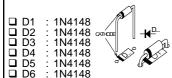

2. Zenerdiode. Watch the polarity!


: 1N4148

: 1N4148

□ D10 : 1N4007




3. Resistors

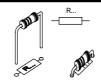


- □ R1 : 4K7 (4-7-2-B) □ R2 : 330 (3-3-1-B) □ R3 : 2M2 (2-2-5-B) □ R4 : 2K2 (2-2-2-B) □ R5 : 10M (1-0-6-B)
- R7 : 470 (4-7-1-B) R8 : 1K (1-0-2-B) R9 : 10K (1-0-3-B)
- R10 : 10K (1 0 3 B) R11 : 10K (1 - 0 - 3 - B) R12 : 10K (1 - 0 - 3 - B)
- R13 : 10K (1 0 3 B)
 R14 : 10K (1 0 3 B)
- □ R14 : 10K (1 0 3 B) □ R15 : 3K3 (3 - 3 - 2 - B)

4. Metal film resistor

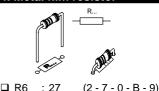


5. IC socket. Watch the po-

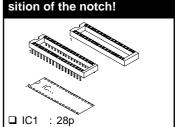



6. Correction network

Fit the diode D8 vertically and with one lead connected for the present.

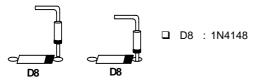


Mount one side of R16 vertically on the anode side of D8.



Then connect the free extremities of each dioderesistor pair together and cut them.





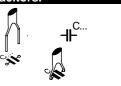


- ☐ C1 : 22pF (22)
- ☐ C2: 100nF (104)
- □ C3 : 100nF (104)
- □ C4: 100nF (104)

8. Transistors.

- T1 : BC557B
- □ T2 : BC557B
 □ T3 : BC557B
- ☐ T4 : BC517





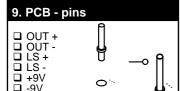

10. Trim potentiometer



11. Electrolytic Capacitors. Watch the polarity!





12. Push buttons




- □ SW1 □ SW2
- SW6
- SW3
 SW4
 SW5
- □ SW8 □ SW9 □ SW10

13. IC Watch the polarity!




14. Axe.

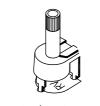

Fit the potentiometer axe.



15. Connection & use

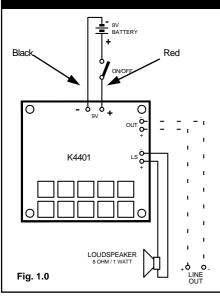

- Turn the potentiometer to its centre position.
- Connect a loudspeaker (8 ohm / 1Watt min.) between the points LS.
- Connect a power supply (9VDC) or a 9V battery between the points +9V and -9V.
- Pressing the different push buttons now causes the respective effects to be produced.



ATTENTION: With some of the effects (e.g. sirens, car engine) it's necessary to keep the push button pressed. The speed of the effects can be changed (optimized) by turning the potentiometer.


The OUT output allows you to extra amplify the sounds or to connect them to a mixing panel. In this case you possibly can disconnect the loudspeaker.

Thanks to the position of the push buttons and of the potentiometer, this circuit can be built into a plastic housing or the pcb be mounted behind a panel very easily.

Loudspeaker & on/off switch are not included!




16. PCB layout.

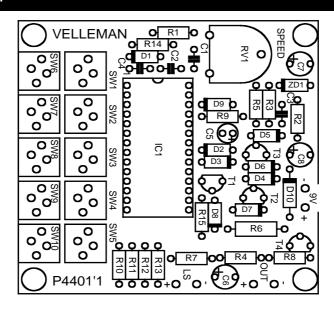



17. Diagram

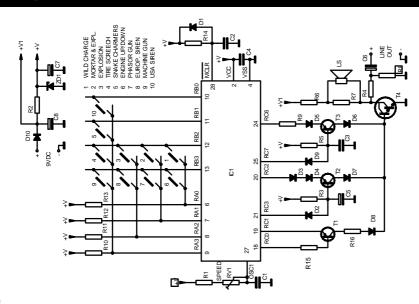



Modifications and typographical errors reserved © Velleman Components nv. H4401IP - 2004 - ED1

